


A. VEHICLE INSPECTION PROCEDURE

1. Verify that the vehicle is within the following ranges:
 - 2006-2007 Mazda3 built from July 1, 2005 through October 17, 2006
 - 2006 VIN Range: (JM1 BK**** 61 400013 – 545533)
 - 2007 VIN Range: (JM1 BK**** 71 600021 – 655250)
 - 2006-2007 Mazda5 built from April 12, 2005 through October 10, 2006
 - 2006 VIN Range: (JM1 CR29** 60 100023 – 131283)
 - 2007 VIN Range: (JM1 CR29** 70 131285 – 139536)
 - 2006-2007 MX-5 built from May 17, 2005 through October 11, 2006
 - 2006 VIN Range: (JM1 NC2*F* 60 100060 – 122881)
 - 2007 VIN Range: (JM1 NC2*F* 70 121113 – 129641)
 - 2007 CX-7 WITHOUT NAVIGATION VIN Range: (JM3 ER29** 70 100058 – 145591) built from February 14, 2006 through October 10, 2006
 - If the vehicle is within the above range, proceed to STEP 2.
 - If the vehicle is not within the above range, return the vehicle to the customer or inventory.
2. Perform a Warranty Vehicle Inquiry using your eMDCS System and inspect vehicle for a Campaign Label **SSP69** attached to the vehicle's hood or bulkhead. Refer to eMDCS System - Warranty Vehicle Inquiry Results table below.

NOTE: Verify SSP number as the vehicle may have multiple SSPs.

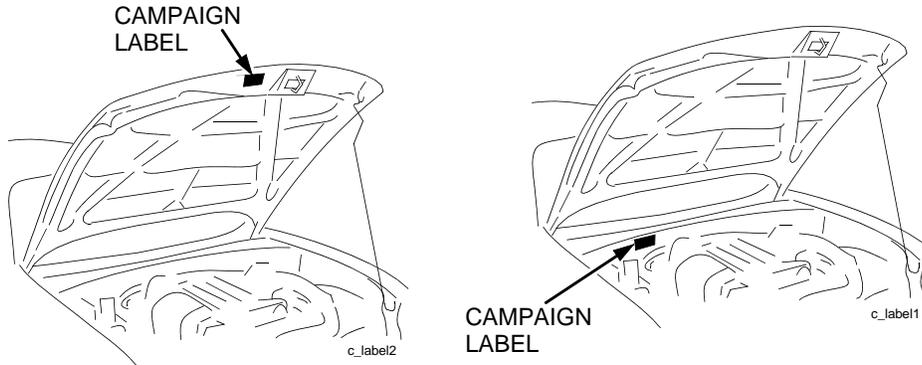

CAMPAIGN LABEL	
CAMPAIGN NO:	_____
DEALER CODE:	_____
DATE:	/ /
P/N 9999-95-065A-05	

1326b

eMDCS System - Warranty Vehicle Inquiry Results

If eMDCS displays:	Campaign Label is:	Action to perform:
SSP69 OPEN	Present	Contact the Mazda Corporate Dealer Assistance Group at (877) 727-6626 to update vehicle history.
	Not present	Proceed to STEP 3.
SSP69 CLOSED	Present	Return vehicle to inventory or customer.
	Not present	Complete a label and apply to vehicle's hood or bulk-head.
SSP69 is not displayed	Not present	Confirm if equipped with Sirius satellite receiver and Clarion Audio head unit, proceed to STEP 3.
	Does not apply	SSP does not apply to this vehicle. Return vehicle to inventory or customer.

3. Verify radio head unit manufacturer:
 - a. Turn ignition switch ON.
 - b. Turn audio system ON, turn volume to zero.
 - c. Press and hold POWER ON/OFF knob, then press Preset #5 button for more than 3 seconds. The information/radio display will show the manufacturer as a code. Refer to the table below.
 - **If M-03 IS displayed**, proceed to STEP 4.
 - **If M-03 IS NOT displayed**, return the vehicle to the customer or inventory.

RADIO HEAD UNIT MANUFACTURER CODES

CODE	MANUFACTURER
M-01 (Not Affected)	Sanyo
M-02 (Not Affected)	Panasonic
M-03 (Affected)	Clarion
M-04 (Not Affected)	Pioneer

4. Verify software version:
 - a. Turn ignition ON.
 - b. Ensure audio system is OFF.
 - c. Press and hold the MEDIA, Preset #5, and Preset #6 buttons simultaneously. The information/radio display will show the software version. Document the software version for use later in the procedure.

VEHICLE	OLD VERSION	CORRECTED VERSION
MX-5, Mazda5, Mazda3	142 or earlier	152 or later
MX-5, Mazda5, Mazda3	143	153 or later
MX-5, Mazda5, Mazda3	146	156 or later
CX-7	023	033 or later

ATTACHMENT II
SSP 69

- If the software version **is the old version** according to the table, proceed to appropriate "REPAIR PROCEDURE" for the vehicle.
- If the software version **is not the old version** according to the table, return the vehicle to the customer or inventory.

REPAIR PROCEDURE REFERENCE

VEHICLE	REPAIR PROCEDURE
Mazda3	B. REPAIR PROCEDURE - MAZDA3
Mazda5	C. REPAIR PROCEDURE - MAZDA5
MX-5	D. REPAIR PROCEDURE - MX-5
CX-7	E. REPAIR PROCEDURE - CX-7